

VN Commodore Fork Rattle

Ref: TNF

Issue date: 10 Dec 2004

Issue number: 2

It has been brought to our attention that after a new clutch kit has been fitted that contains bearing part number BRG 2204 or BRG 2110, a rattle from the bearing and clutch fork area is apparent.

THE FIELD FIX FOR THIS PROBLEM IS AS FOLLOWS

Check clutch fork rubber absorber bushes as per the diagram and in the event that these bushes are worn, they must be replaced.

NOTE: Bearing must be a tight fit

CAUSE

The design of the fork and the window of the bell-housing where the fork protrudes cause the fork to drop and rattle against the window of the bell-housing when the fork absorber rubbers are worn.

Replacement absorber rubbers x 2 (GM-Holden part number # 3994273) are required.

