

Tech Note 102

Amarok Slow Pedal Return


Ref: TN102

Issue Date: Feb 18

Issue Number: 1

If the clutch pedal on this vehicle is slow to return or there are signs of leakage around the concentric slave cylinder, the breather assembly may require replacement.

The breather assembly connects to the inlet of the concentric slave cylinder as depicted below.

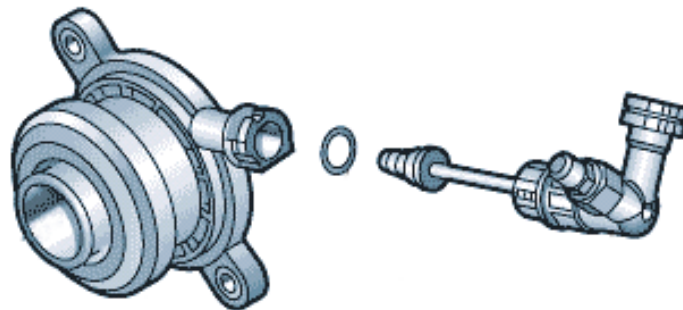

Replacement breather assemblies are available from your EXEDY distributor, quote part number HDL04.

