

Tech Note 102


Amarok Slow Pedal Return

Ref: TN102

Issue Date: May 23

Issue Number: 2

Issues relating to slow pedal return are commonly the result of perished seals within the clutch hydraulic delivery line. To avoid slow pedal return issues, it is highly recommended the replacement seal kit (EXEDY Part No. SEAL03) supplied as part of this clutch kit be fitted upon clutch installation. Please refer to below image for location of seals along the respective type of hydraulic delivery line.

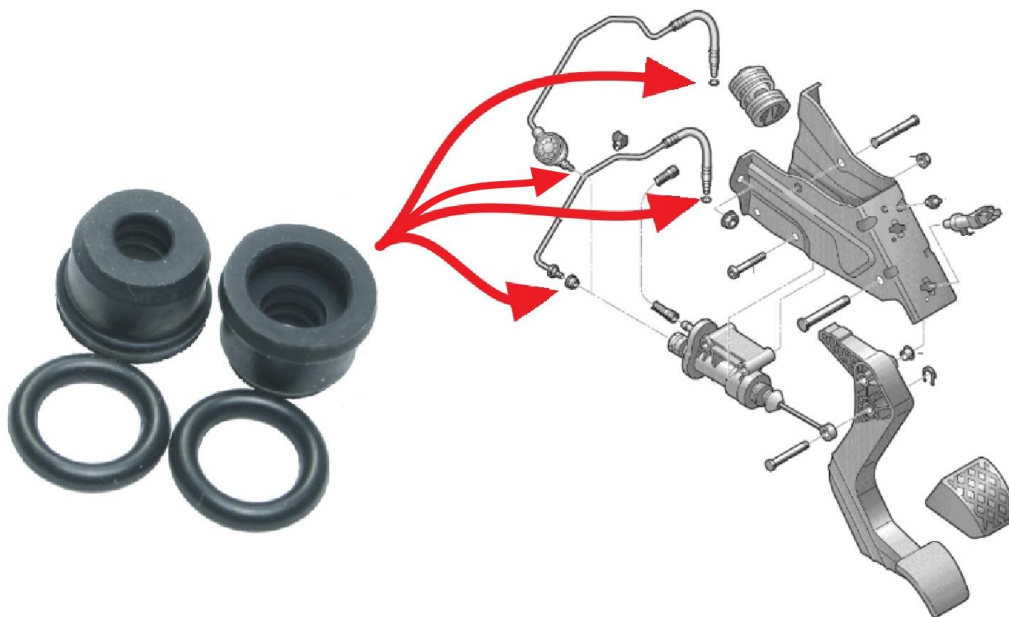

The breather assembly connecting the hydraulic delivery line to the concentric slave cylinder (as depicted below) may also contribute to the above-mentioned concern. Replacement breather assemblies are available from your EXEDY distributor, quote part number HDL04.

