


Important Information

Severe elongation of the bell housing locating dowel holes is a known concern in this application.

Driveline misalignment caused by this concern and the resultant harmonic vibration through the transmission may result in disengagement of gear whilst driving (commonly 5th) and a significantly reduced clutch service life.

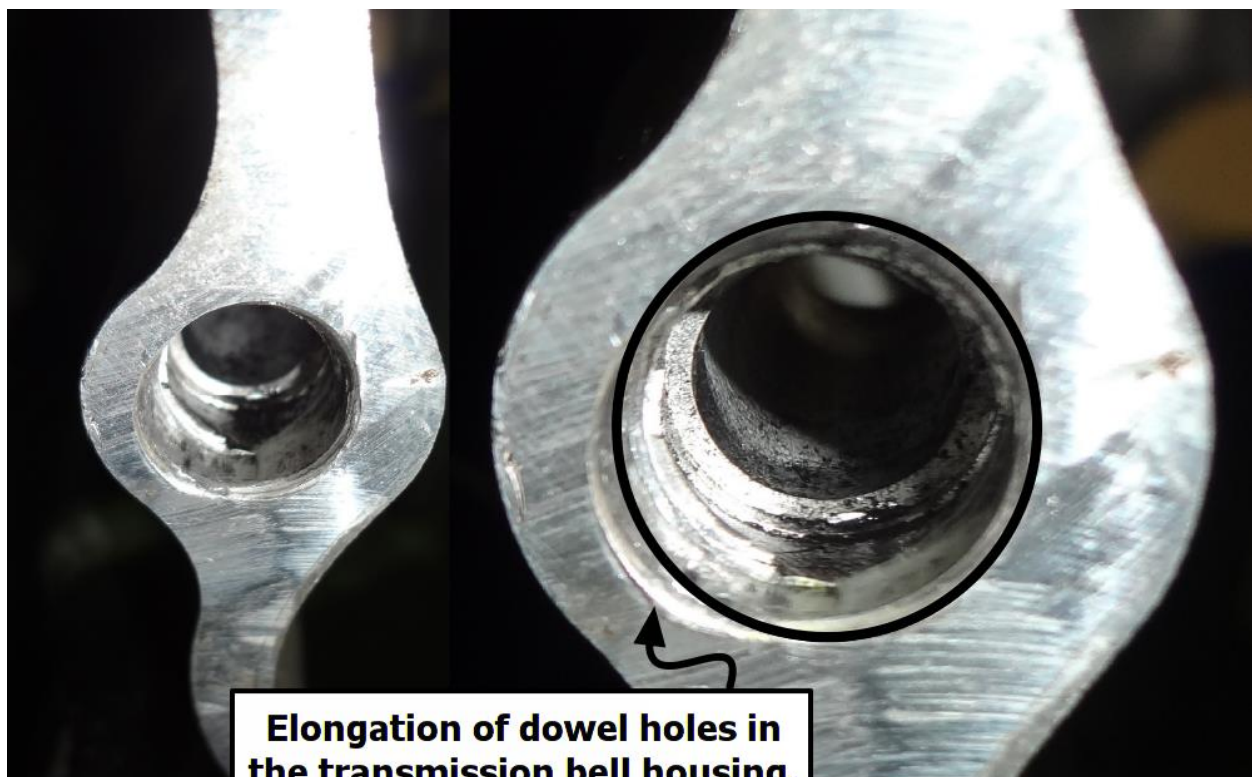

Original image courtesy of Autodata